


Remove/install Multimedia Connection Unit In Front Stowage Compartment - AR82.60-P-1032NKM**MODEL 117, 156, 176, 242, 246 as of model year 2016**

Fig 1: Multimedia Connection Unit In Front Stowage Compartment Remove/Install Components



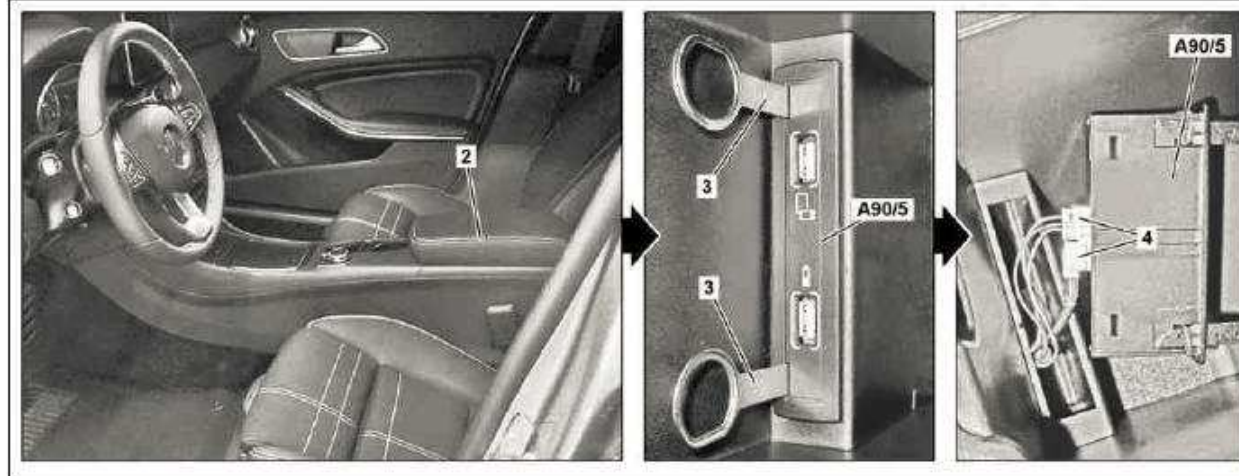

P82.60-9599-08

A90/5 Multimedia connection unit
2 Armrest of center console

3 Removal assembly
4 Electrical connectors

Courtesy of MERCEDES-BENZ USA

	Information on preventing damage to electronic components due to electrostatic discharge		AH54.00-P-0001-01A
	Remove/install		
1	Open armrest of center console (2)		




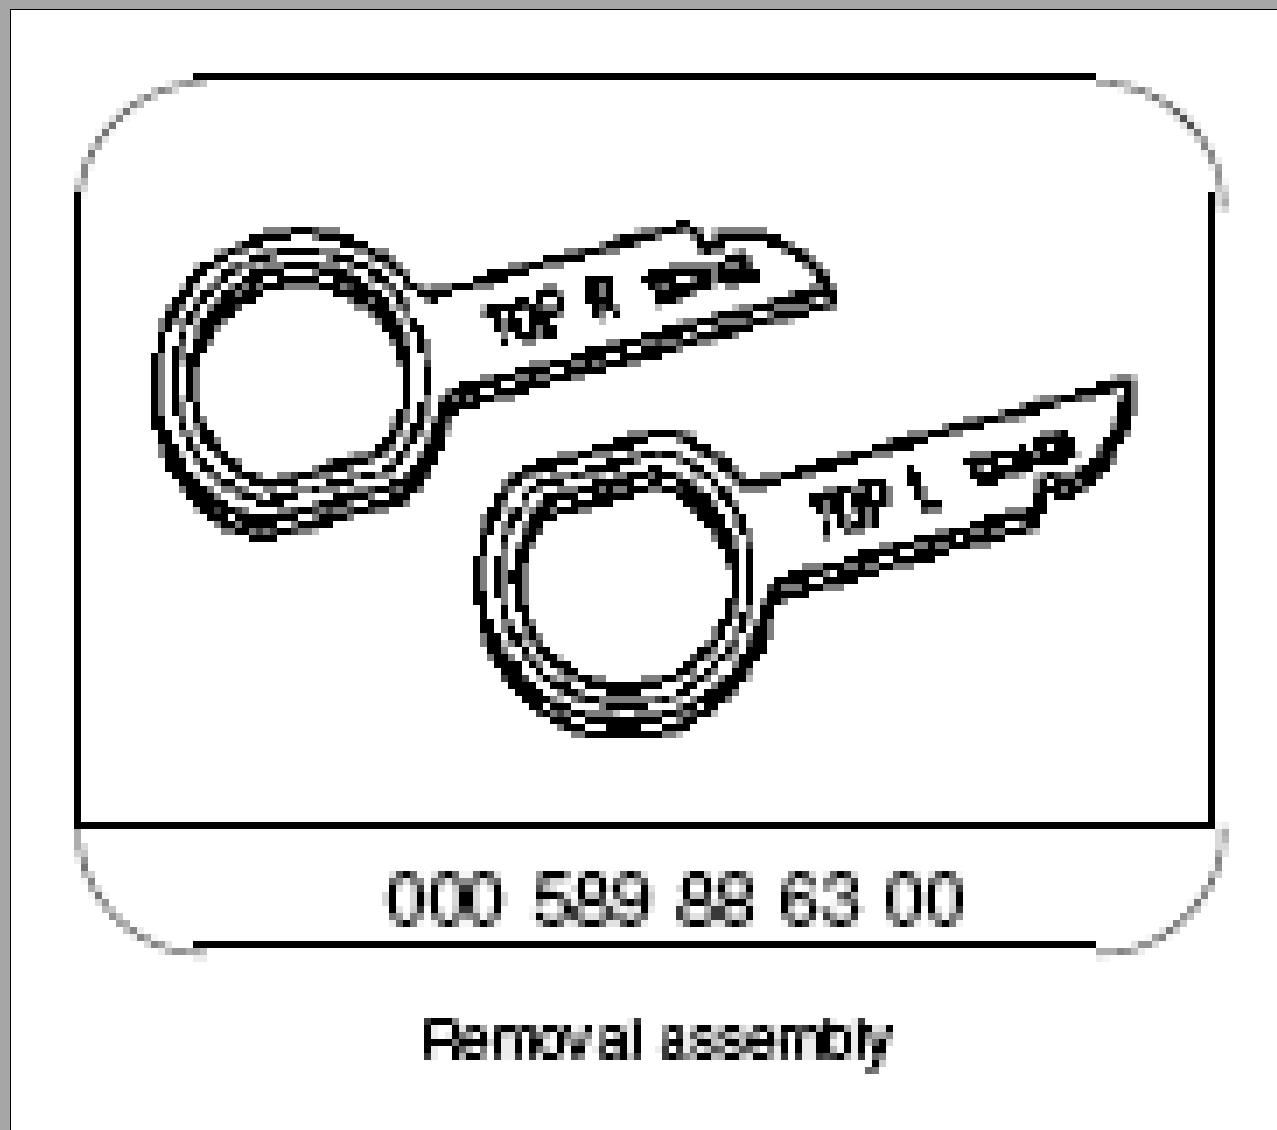
2	Insert removal fixtures (3) in openings of multimedia connection unit (1)	 Removal assembly	Fig 2
3	Pull multimedia connection unit (1) out of center console with lines attached	 Removal assembly	Fig 2
4	Disconnect electrical connections (4)		
5	Press locks on multimedia connection unit (1) and pull removal fixtures (3) out of multimedia connection unit (1)	 Removal assembly	Fig 2
6	Install in the reverse order		

Fig 2: Removal Assembly (000 589 88 63 00)



Courtesy of MERCEDES-BENZ USA